

Work Order ID 85250

June-05-12 9:11:17 AM

85250

Page 1

Item ID: D412-742-043

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Replacement Float Skidtube

Stop ***NS2***

Start Date: 05/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MLJ

Date: 12/06/05 Tooling:

Date:

Run Start ***NR1***

QC:

Date: SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D3391

I

100

0.00

100

DOCUMENT CONTROL


DC

Memo

0.00

Document Control

If D412-742-043 is a W/O on it's own,
Photocopy bluefile and create labels per PPP D412-742-043 CHG005

N/A 

Work Order ID 85250

June-05-12 9:11:17 AM

85250

Page 2

Item ID: D412-742-043

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Float Skidtube

Start Date: 05/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
110		0.00							
110	HandFinishing								
HandFinish	Memo	0.00							
Hand Finishing	1-Install tubes together and seal them all the way around using Sikaflex 241/291. Ensure tube ends line-up with saddle holes for proper alignment. using 7/16" "T" Pins. A/RSikaflex-241/-291 <u>M171409</u> Expiry date: <u>13/03</u>								
	2-Install wearplates as per Dwg D3391. Ensure that plastic washers are against wearplate, then topped with the SS washer. Seal all bolts with sikaflex except ones with inserts on inside of tube ,hand tighten only bolts with no sikaflex. A/RSikaflex-241/-291 <u>M171409</u> Expiry date: <u>13/03</u>								
	3-Remove "T" pins once sikaflex is dry.								
	4-Coat all exposed hardware with LPS Procyon. Remove any excess off with MEK degreaser. A/RLPS Procyon <u>M1114596</u>								

Handwritten notes and signatures:
1x f M1206125

Work Order ID 85250

85250

Page 3

June-05-12 9:11:17 AM

Item ID: D412-742-043

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Replacement Float Skidtube

Stop ***NS2***

Start Date: 05/06/2012 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	QC5- Inspct part completeness to step on W/O	0.00							
120									
QC	Memo	0.00							
Quality Control									
130		0.00							
130	Packaging								
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPP D412-742-043								
	Location: _____								
	PPP Rev: <u>PPP 80 240</u>								
140	QC21- Final Inspection - Work Order Release	0.00							
140									
QC	Memo	0.00							
Quality Control									

Rev 7/4 (1)

12/7/5

MF

12-07-04

June-05-12 9:11:21 AM

85250

D412-742-043

Required Date: 19/06/2012

Required Qty: 1.00

Comments:

IPP Rev A	05.10.13	New Issue	KJ/JLM	
IPP Rev	06.02.13	ECN 773 dwg @ rev.D	EC	
IPP Rev:C	07-05-28	As per Rev F	JLM	
IPP Rev:D	07-12-04	ECN 1072	DD verified by:JLM	
IPP Rev:E	08-09-08	ecn 08-510	DD verified by:EC	IPP Rev:F
11.11.01	as per DS19517	REV.B	DD verified by:EC	

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D3391-021		Manufactured	No			110	Each	0.0000	1	1			
<p>*D3391-021*</p> <p>Fwd Tube Assembly</p> <p><i>Handwritten: A. made on D3391-023</i></p>													
D3391-023		Manufactured	No			110	Each	0.0000	1	1			
<p>*D3391-023*</p> <p>Mid Tube Assembly</p>													
				<u>Location</u>			<u>Loc Qty</u>			<u>Loc Code</u>			
				FP			1						
				GA			-1						
D3391-025		Manufactured	No			110	Each	0.0000	1	1			
<p>*D3391-025*</p> <p>Aft Tube Assembly</p>													
AN3C4A		Purchased	No			110	Each	1,362.000	24	24			
<p>*AN3C4A*</p> <p>BOLT</p>													
				<u>Location</u>			<u>Loc Qty</u>			<u>Loc Code</u>			
				ST350			1362						
				120187			57						
				120521			28						
				120769			38						
				121205			1000						
				121556			239						

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> Other <input type="checkbox"/> </div> <div> Engineering Quality <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Offset/Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unauthorized <input type="checkbox"/>											

FAULT CATEGORY												
Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many			General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing			<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material		<input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other _____ _____ _____	

Picklist Print

June-05-12 9:11:21 AM

Page 2

Work Order ID: 85250

Parent Item: D412-742-043

Parent Item Name: Replacement Float Skidtube

85250

D412-742-043

Start Date: 05/06/2012

Required Date: 19/06/2012

Start Qty: 1.00

Required Qty: 1.00

AN3C6A

Purchased

No

110

Each

451.0000

10

10

AN3C6A

BOLT

**

11/06/27

Location

Loc Qty

Loc Code

FP001

1

111982

1

ST351

450

111982

2

116419

23

116549

2

116704

12

117619

10

117688

1

117872

5

118422

13

119449

21

120423

3

120693

158

121682

200

110

AN3C7A

Purchased

No

110

Each

140.0000

4

4

AN3C7A

BOLT

**

11/06/27

Location

Loc Qty

Loc Code

ST351

140

113149

14

116169

1

117313

10

117619

12

117688

6

119749

1

120731

8

121185

50

121541

38

110

June-05-12 9:11:21 AM

Shop Packet Print

Page 2

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width: 25%;">Skid-tube <input type="checkbox"/></td> <td style="width: 25%;">Crosstube <input type="checkbox"/></td> <td style="width: 25%;">Prod. Eng. Coord. <input type="checkbox"/></td> <td style="width: 25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td><input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> <td><input type="checkbox"/></td> </tr> </table>						Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>	<input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	<input type="checkbox"/>
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Engineering <input type="checkbox"/>																								
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Quality <input type="checkbox"/>																								
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Supplier <input type="checkbox"/>	<input type="checkbox"/>																								
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Other <input type="checkbox"/>	<input type="checkbox"/>																								
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector																		
Doc/Data <input type="checkbox"/>																											
Equip/Tooling <input type="checkbox"/>																											
Operator <input type="checkbox"/>																											
Material <input type="checkbox"/>																											
Offset/Setup <input type="checkbox"/>																											
Other <input type="checkbox"/>																											
Process <input type="checkbox"/>																											
Supplier <input type="checkbox"/>																											
Training <input type="checkbox"/>																											
Unauthorized <input type="checkbox"/>																											
FAULT CATEGORY																											
Landing Gear <input type="checkbox"/> Bending Passes Below Min <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimp at Bending <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Other <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Ripples on Inner Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			Hardware <input type="checkbox"/> Breaking <input type="checkbox"/> Missing <input type="checkbox"/> Size/Length <input type="checkbox"/> Spinning <input type="checkbox"/> Threading <input type="checkbox"/> Wrong Drill Holes <input type="checkbox"/> Misaligned <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Undersized <input type="checkbox"/> Too Many			General <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Documentation/Data <input type="checkbox"/> Finish <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Inspection Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Jigs/Fixtures/Tooling <input type="checkbox"/> Kit Incorrect <input type="checkbox"/> Kit Missing			<input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Off-Set <input type="checkbox"/> Orientation Misread <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Lost <input type="checkbox"/> Part Moved <input type="checkbox"/> Raw Material			<input type="checkbox"/> Set-up <input type="checkbox"/> Supplier <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other _____ _____ _____															

Picklist Print

June-05-12 9:11:21 AM

Page 3

Work Order ID: 85250

85250

Parent Item: D412-742-043

D412-742-043

Parent Item Name: Replacement Float Skidtube

Start Date: 05/06/2012

Required Date: 19/06/2012

Start Qty: 1.00

Required Qty: 1.00

AN960C10L

NAS1149C0332

Purchased

No

110

Each

0.0000

38

38

*AN960C10L *

washer

D4095-041

Manufactured

No

110

Each

0.0000

1

1

D4095-041

Wearplate Assembly

D4095-043

Manufactured

No

110

Each

1.0000

1

1

D4095-043

Wearplate Assembly

M122063

**

(38x) MU 12/06/12

B83809

**

(x1) MU 12/06/12

B83479

**

(x1) MU 12/06/12

Location

Loc Qty

Loc Code

FP001

1

81624

1

D4095-045

Manufactured

No

110

Each

15.0000

1

1

D4095-045

Wearplate Assembly

**

MU 12/06/12

Location

Loc Qty

Loc Code

FP

1

81625

1

FP001

14


77737

1

84081

13

YU

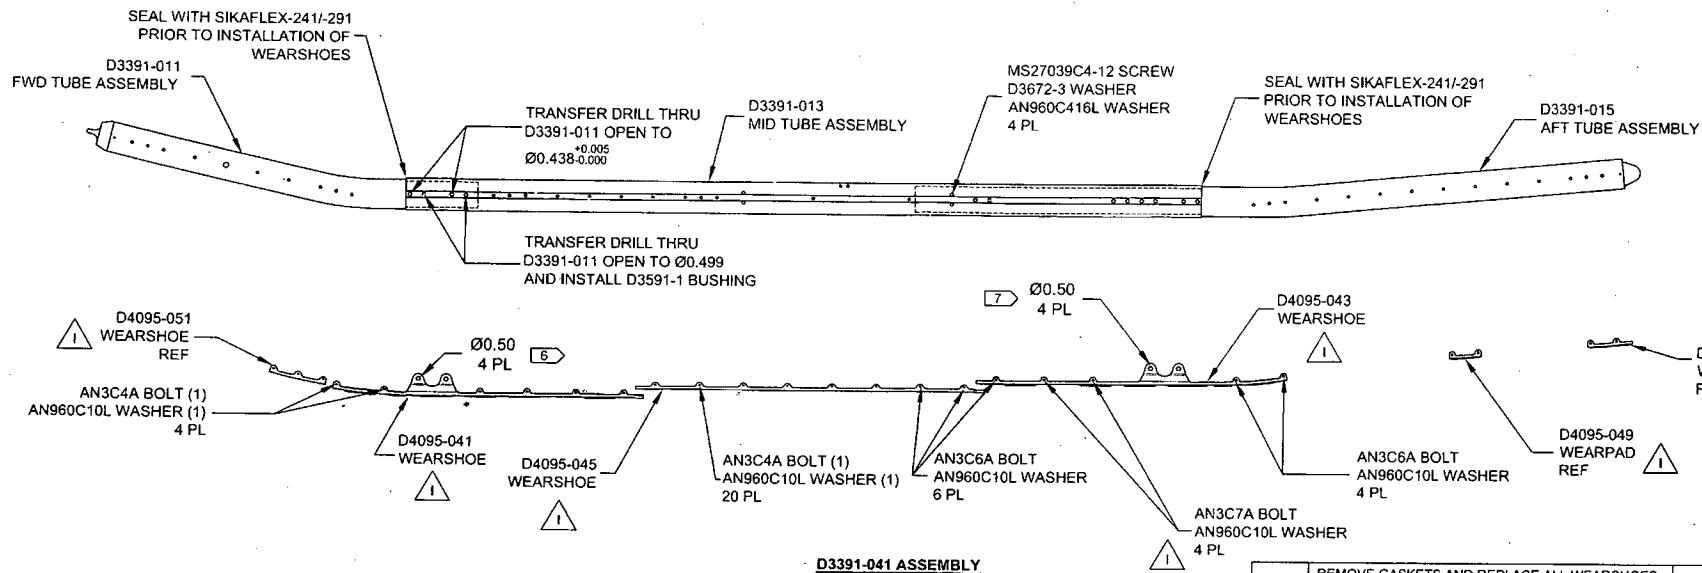

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY -041	PART NUMBER	DESCRIPTION
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
4	D3672-3	WASHER
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARSHOE
1	D4095-049	WEARSHOE
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL 0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 6) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL 0.50 HOLES FROM SADDLE TO D4095-041
- 7) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL 0.50 HOLES FROM SADDLE TO D4095-043

RELEASED
2011-11-04
ECN# 11-662


I	REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A6-4, ZN B6-8; LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B6-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D8-4 ZN D2-4, ZN D7-8, ZN D3-8	XDF	11.10.13
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 0.438 DIM WAS 4 PL. ADDED 0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 0.438 DIM WAS 4 PL. ADDED 0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET. REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH		
DRAWN	XDF		
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	11.10.13		

DART AEROSPACE USA, INC
KENT, WA

DRAWING NO. REV. I
D3391 SHEET 1 OF 8
TITLE SCALE
412 FLOAT SKIDTUBE NTS

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

85250

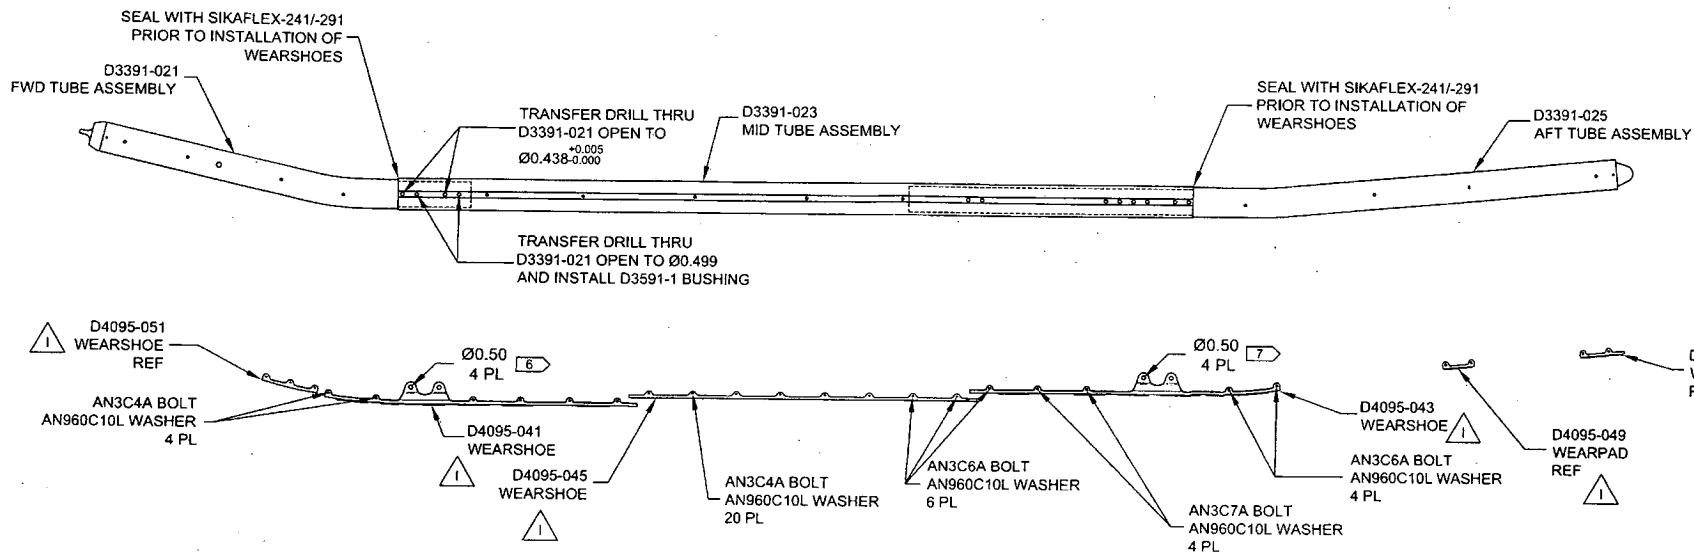

D3391-043 ASSEMBLY





D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARPAD
1	D4095-049	WEARPAD
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
36	AN960C10L	WASHER

GENERAL NOTES


- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"
- 3) AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 4) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 5) UNITS: INCHES UNLESS OTHERWISE NOTED
- 6) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. CBORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 7) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 8) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043

RELEASED
2011-11-04


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV.
MFG. APPR.		D3391	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

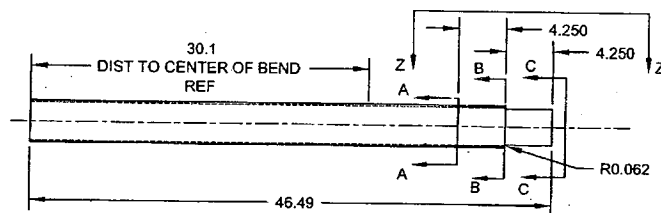


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

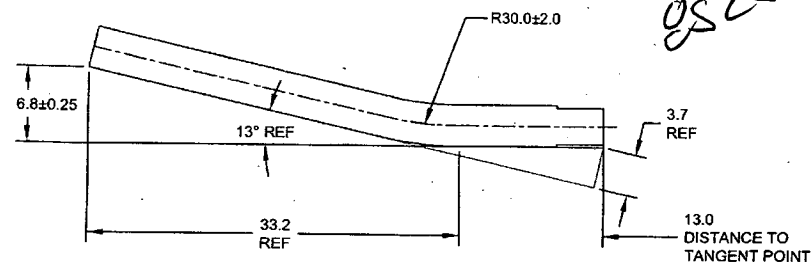


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

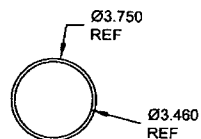


SECTION A-A
SCALE 2X

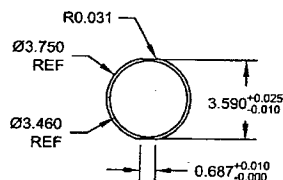

SECTION B-B
SCALE 2X

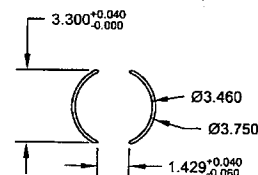

SECTION C-C
SCALE 2X

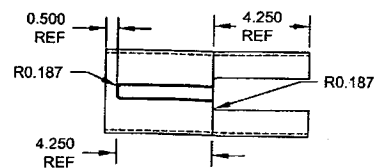


VIEW Z-Z
SCALE 2X

RELEASED
2011-11-04


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2003 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

85250

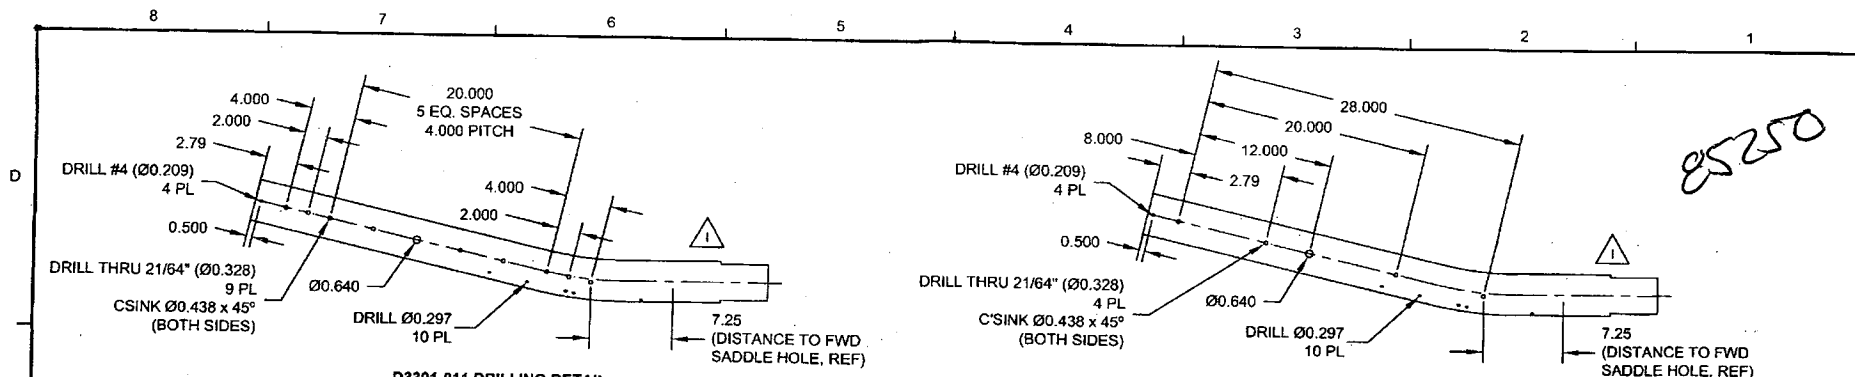


D3391-011 DRILLING DETAIL

D3391-021 DRILLING DETAIL

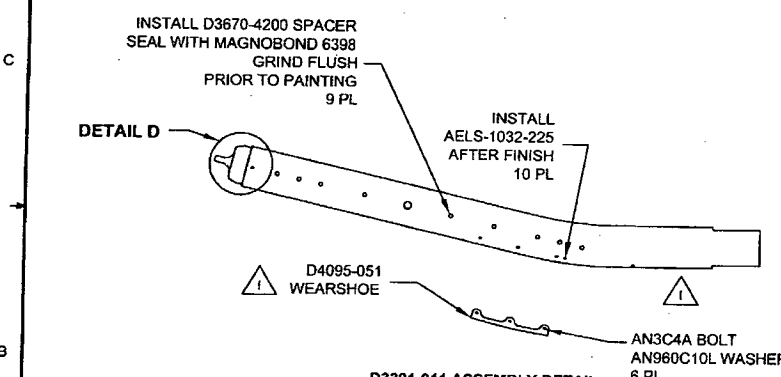


D3391-011 ASSEMBLY DETAIL

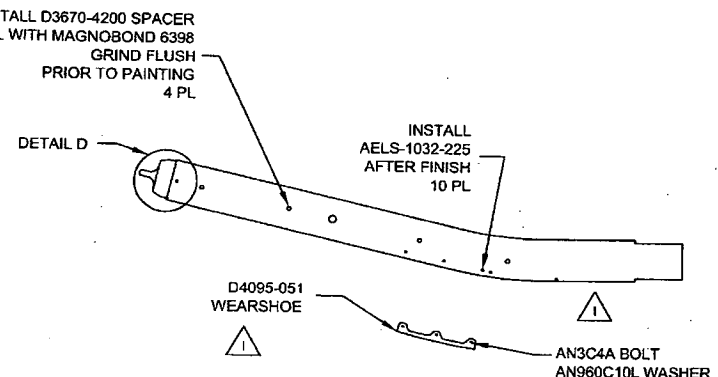

D3391-021 ASSEMBLY DETAIL

D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST







QTY - 011	QTY - 021	PART NUMBER	DESCRIPTION
X		D3391-011	FWD TUBE ASSEMBLY
	X	D3391-021	FWD TUBE ASSEMBLY
1	1	D3401-041	TOW CAP
9	4	D3670-4200	SPACER
4	4	D3672-1	WASHER
1	1	D4095-051	WEARSHOE
1	1	D6013-047	FWD TUBE
10	10	AN3C4A	BOLT
10	10	AN960C10L	WASHER
10	10	AELS-1032-225	INSERT

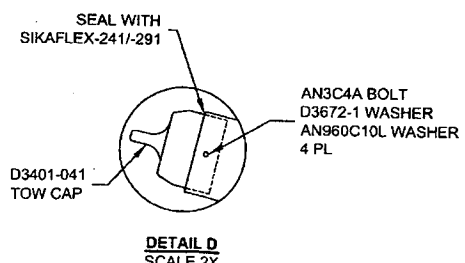

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 4 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED BY THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

85256

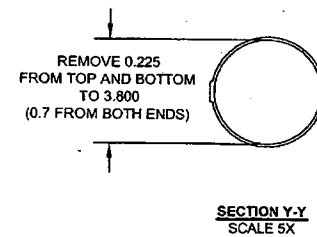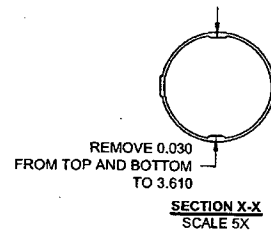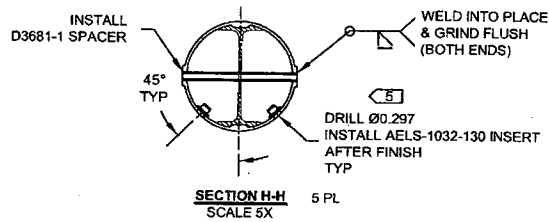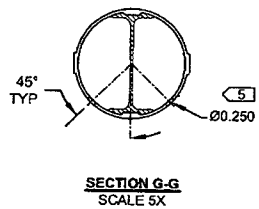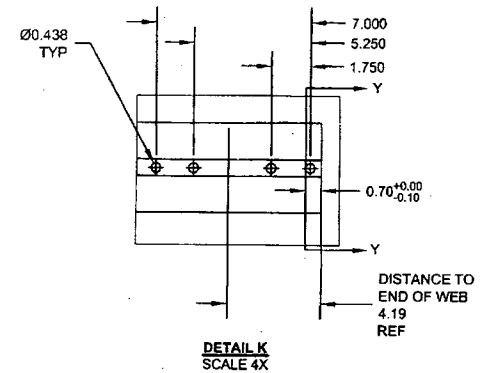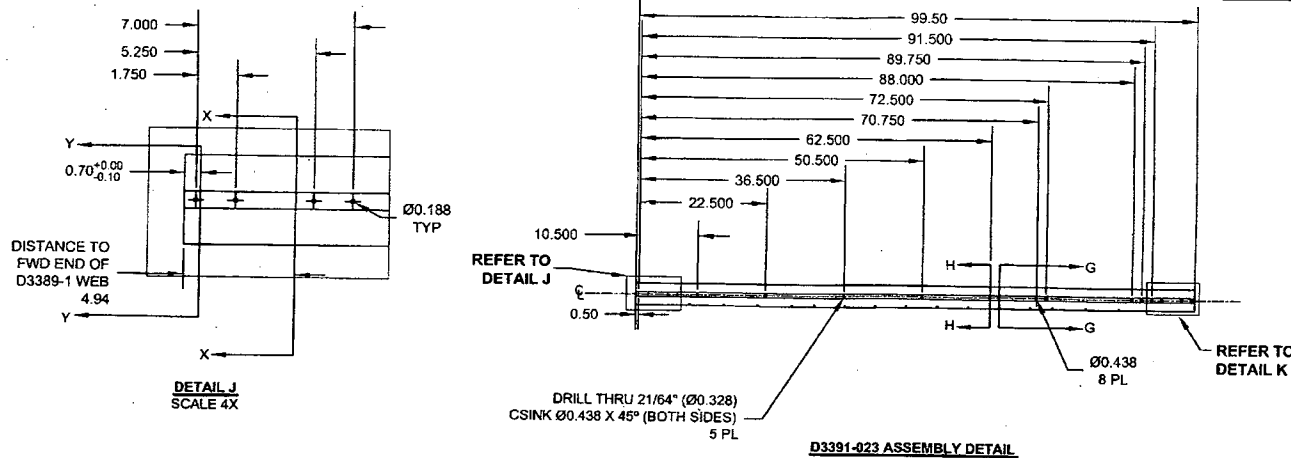

D3391-023 MID TUBE ASSEMBLY PARTS LIST


QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT




D3391-023 MID TUBE ASSEMBLY


- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004

RELEASED
2011-11-04

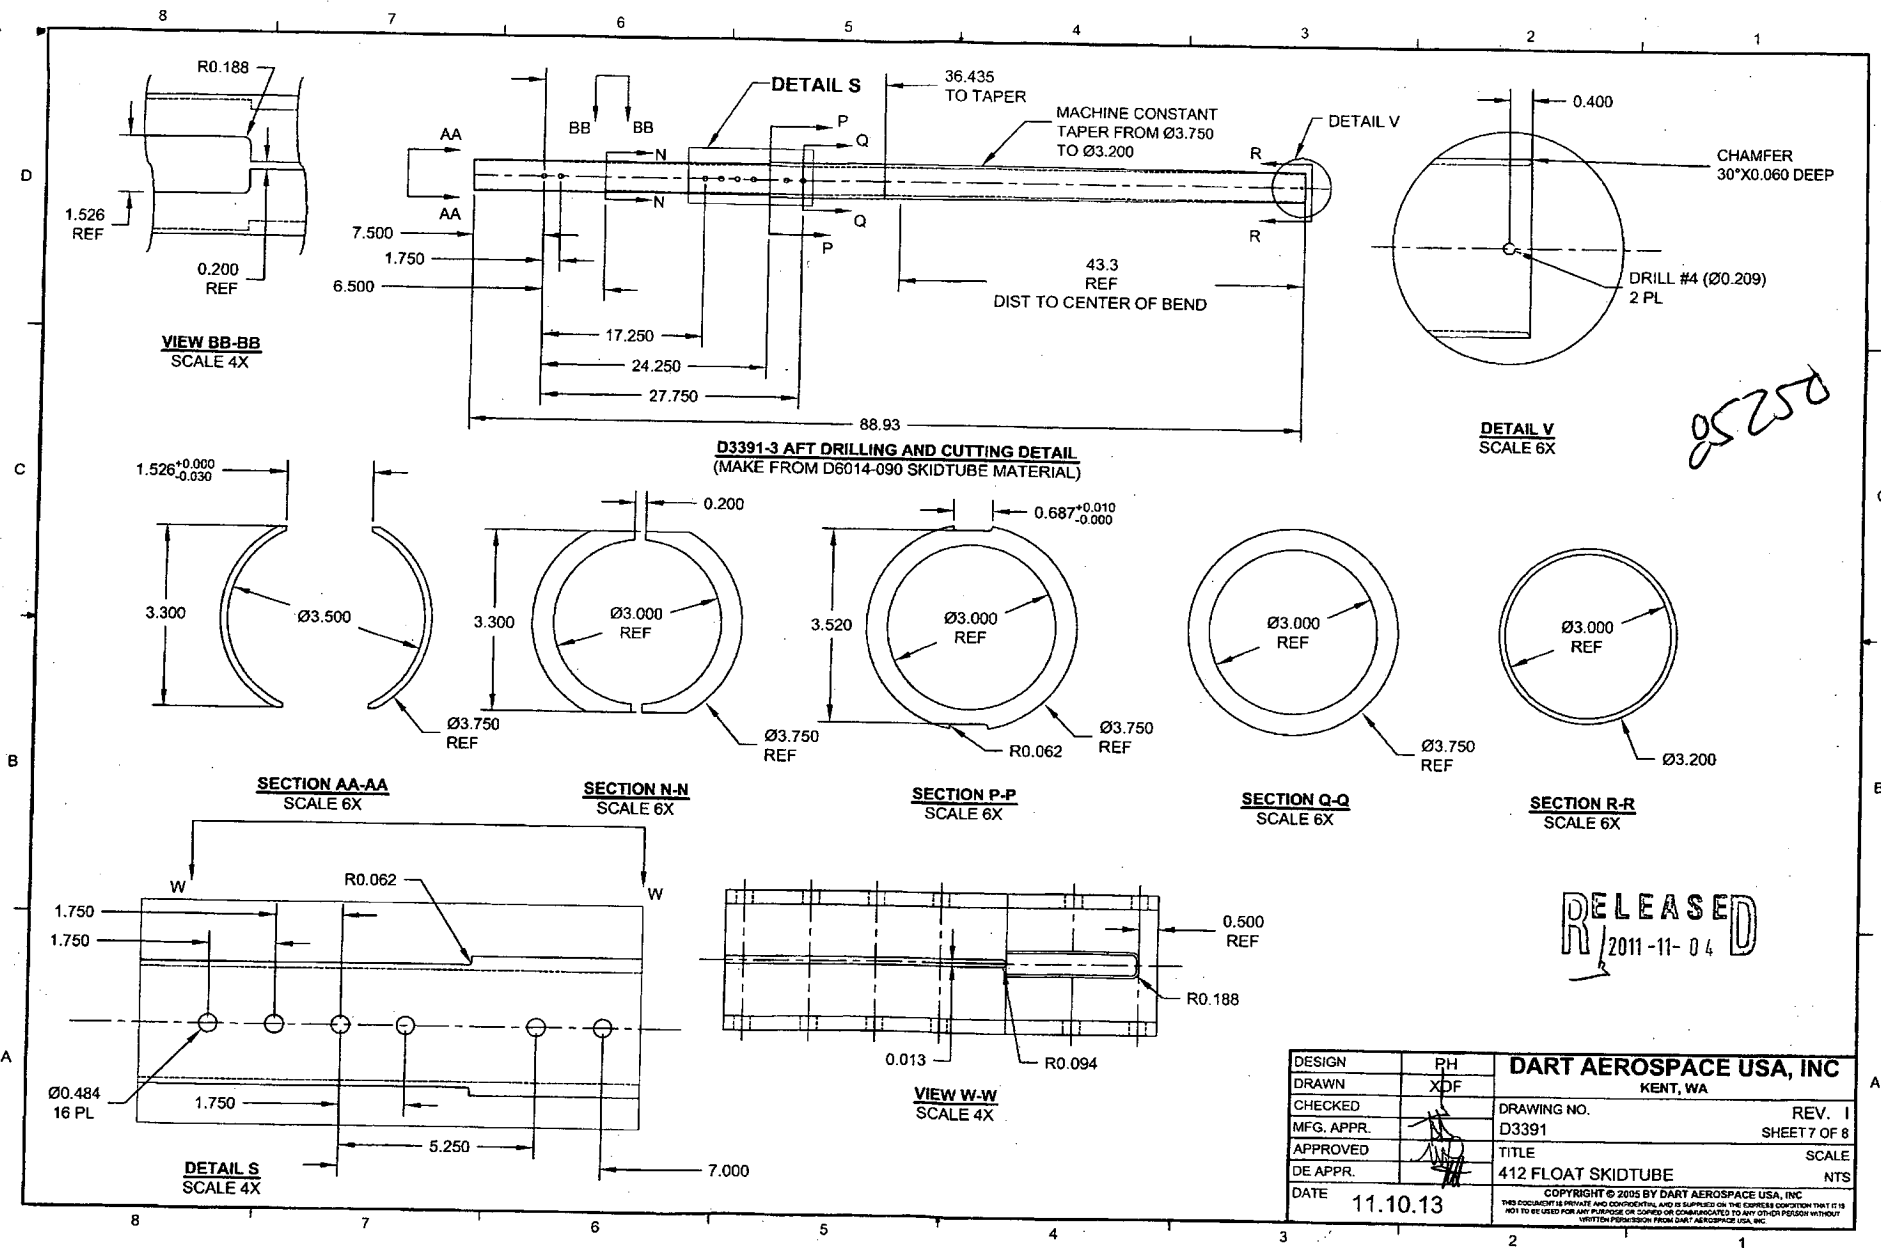DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	




DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

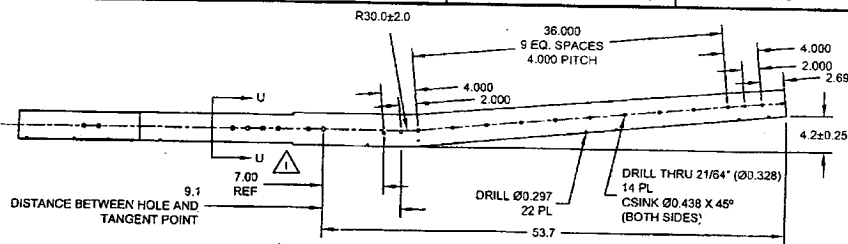

D3391-015 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING
14 PL

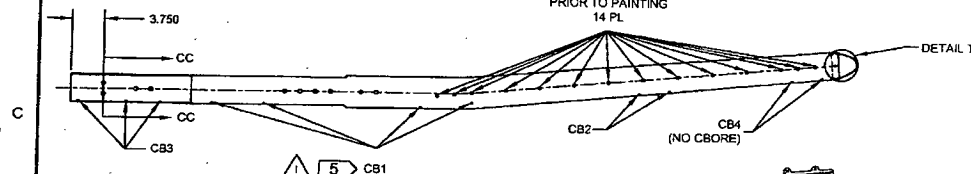



D3391-015 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

D3391-015-025 AFT TUBE ASSEMBLY PARTS LIST


QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
	X	D3391-025	AFT TUBE ASSEMBLY
1	1	D2646	AFT CAP
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
1	1	D4095-049	WEARPAD
1	1	D4095-047	WEARPAD
1	1	D6014-090	AFT TUBE
14	14	AELS-1032-130	INSERT
8	8	AELS-1032-225	INSERT
4	4	ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	8	8	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

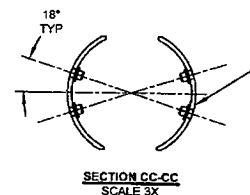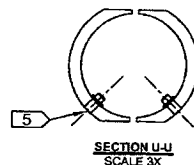

DRILL Ø0.391
CBORE Ø0.516 X 0.040 DEEP
INSTALL ALS4-428-165 INSERT
4 PL

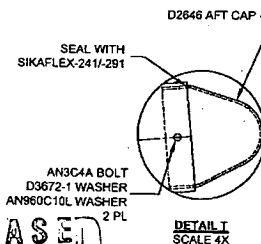

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC
DRAWN	XDF	KENT, WA
CHECKED		DRAWING NO. REV. 1
MFG. APPR.		D3391 SHEET 8 OF 8
APPROVED		TITLE SCALE
DE APPR.		412 FLOAT SKIDTUBE NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT THE WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.